## GENERAL NOTES (APPLIES TO A201 & A202)

A. EXISTING WINDOWS: EXISTING STORM PANELS ON UPPER PORTIONS OF UPPER LEVEL WINDOWS ARE TO REMAIN. REPLACE BROKEN GLASS TO MATCH EXISTING. SEE DRAWING NOTES FOR LOCATIONS. RE-PUTTY ALL WINDOWS EXCEPT UPPER PORTIONS WITH EXISTING STORM PANELS. PAINT EXTERIOR WINDOWS AND TRIM.

B. REPAIR OPERABLE SASHES AND REPLACE ROPES AND WEIGHTS TO PROVIDE PROPER OPERATING UNITS. APPLIES TO (4) EXISTING DOUBLE HUNG WINDOWS ON NORTH ELEVATION.

C. PROVIDE NEW FIXED STORM WINDOWS ON EXTERIOR OF ALL EXISTING WINDOWS EXCEPT AS NOTED ABOVE. (BOTH LEVELS). GLASS TYPE GL-7 IN ALUMINUM FRAME

D. LIGHTLY CLEAN INTERIOR WINDOW WOODWORK AND TRIM. REPLACE MISSING OR DAMAGED PIECE. PAINT TO MATCH FINISH OF EXISTING.

E. MASONRY AND STONE: REMOVE IVY AND ANY OTHER VEGETATIVE GROWTH. REMOVE ALL EFFLORESCENCE. PATCH LIMESTONE AS INDICATED.

## DRAWING NOTES

01. BRICK TO MATCH EXISTING

02. ALUMINUM FRAMED GLASS STOREFRONT

03. PREFINISHED INSULATED METAL PANEL.

04. INDIANA LIMESTONE TO MATCH EXISTING TYPE, COLOR, AND TEXTURE. STONE TO BE SMOOTH WITH NO REVEALS.

05. FACE BRICK SOLDIER COURSE AT EACH WINDOW.

06. CONTROL JOINT. PROVIDE SEALANT, FULL HEIGHT.

## DRAWING NOTES - CONTINUED

07. METAL COLUMN

08. PROVIDE MASONRY IN FILL AT EXISTING REMOVED WINDOWS. MATCH THICKNESS OF EXISTING ADJACENT CONSTRUCTION.

09. REPOINT 20% OF MORTAR JOINTS AT EXISTING CHIMNEY. AT CONTRACTORS OPTION, REMOVE TOP 10' AND PROVIDE SOLID LIMESTONE CAP.

10. CAREFULLY REMOVE ALL VINYL FASCIA AND SOFFIT CLADDING TO EXPOSE WOOD FASCIA, SOFFIT, MOLDINGS AND TRIM. USE CARE TO MINIMIZE DAMAGE TO EXISTING WOOD. REPAIR DAMAGED AND SPLIT WOOD. PROVIDE ADDITIONAL WOOD TRIM AS REQUIRED TO MATCH PROFILE ON DETAIL 06/A503. PLUG AND PATCH HOLES. PAINT ALL WOOD MOULDINGS AND TRIM. IF DETERIORATED SECTIONS OF WOODWORK ARE DISCOVERED PROVIDE REPLACEMENT BASED ON ESTABLISHED UNIT PRICES. OBTAIN APPROVAL FROM ARCHITECT PRIOR TO PERFORMING UNIT PRICE REPAIRS.

11. REPLACE EXISTING PVC DOWNSPOUTS WITH NEW 4 INCH DIAMETER PRE FINISHED GALVANIZED STEEL CORRUGATED ROUND DOWNSPOUT. PROVIDE PVC BOOT AT GRADE.

12. REPLACE BROKEN OR MISMATCHED PIECES OF GLASS (SHOWN SHADED). REPLACE BROKEN OR MISMATCHED GLASS PIECES ON LOWER LEVEL WITH TRANSLUCENT PATTERN GLASS TO MATCH EXISTING. REPLACE BROKEN OR MISMATCHED GLASS PIECES ON UPPER LEVEL WITH CLEAR GLASS TO MATCH EXISTING.

13. PRE FINISHED METAL GRAVEL STOP

14. FACE BRICK HEADER COURSE.

15. PRE FINISHED METAL FASCIA

16. REMOVE EXISTING WINDOW AIR CONDITIONING UNIT. REPAIR DAMAGED LOWER SASH, INSTALL NEW WOOD MUNTINS AND GLASS TO MATCH ADJACENT WINDOWS.

SOUTH

ELEVATION

1/4 SCALE 0 2 4 6FT

02

## DRAWING NOTES

01. BRICK TO MATCH EXISTING

02. ALUMINUM FRAMED STOREFRONT AND DOORS WITH CLEAR LOW-E GLASS

03. PREFINISHED METAL GRAVEL STOP.

04. METAL COLUMN

05. INDIANA LIMESTONE TO MATCH EXISTING TYPE, COLOR, AND TEXTURE. STONE TO BE SMOOTH WITH NO REVEALS.

06. PREFINISHED INSULATED METAL PANEL.

07. NOT USED.

08. REPOINT 20% OF MORTAR JOINTS AT EXISTING CHIMNEY. AT CONTRACTORS OPTION, REMOVE TOP 10' AND PROVIDE SOLID LIMESTONE CAP.

09. CAREFULLY REMOVE ALL VINYL FASCIA AND SOFFIT CLADDING TO EXPOSE WOOD FASCIA, SOFFIT, MOLDINGS AND TRIM. USE CARE TO MINIMIZE DAMAGE TO EXISTING WOOD. REPAIR DAMAGED AND SPLIT WOOD. PROVIDE ADDITIONAL WOOD TRIM AS REQUIRED TO MATCH PROFILE ON DETAIL 06/A503. PLUG AND PATCH HOLES. PAINT ALL WOOD MOULDINGS AND TRIM. IF DETERIORATED SECTIONS OF WOODWORK ARE DISCOVERED PROVIDE REPLACEMENT BASED ON ESTABLISHED UNIT PRICES. OBTAIN APPROVAL FROM ARCHITECT PRIOR TO PERFORMING UNIT PRICE REPAIRS.

10. REPLACE EXISTING PVC DOWNSPOUTS WITH NEW 4 INCH DIAMETER PREFINISHED GALVANIZED STEEL CORRUGATED ROUND DOWNSPOUTS.

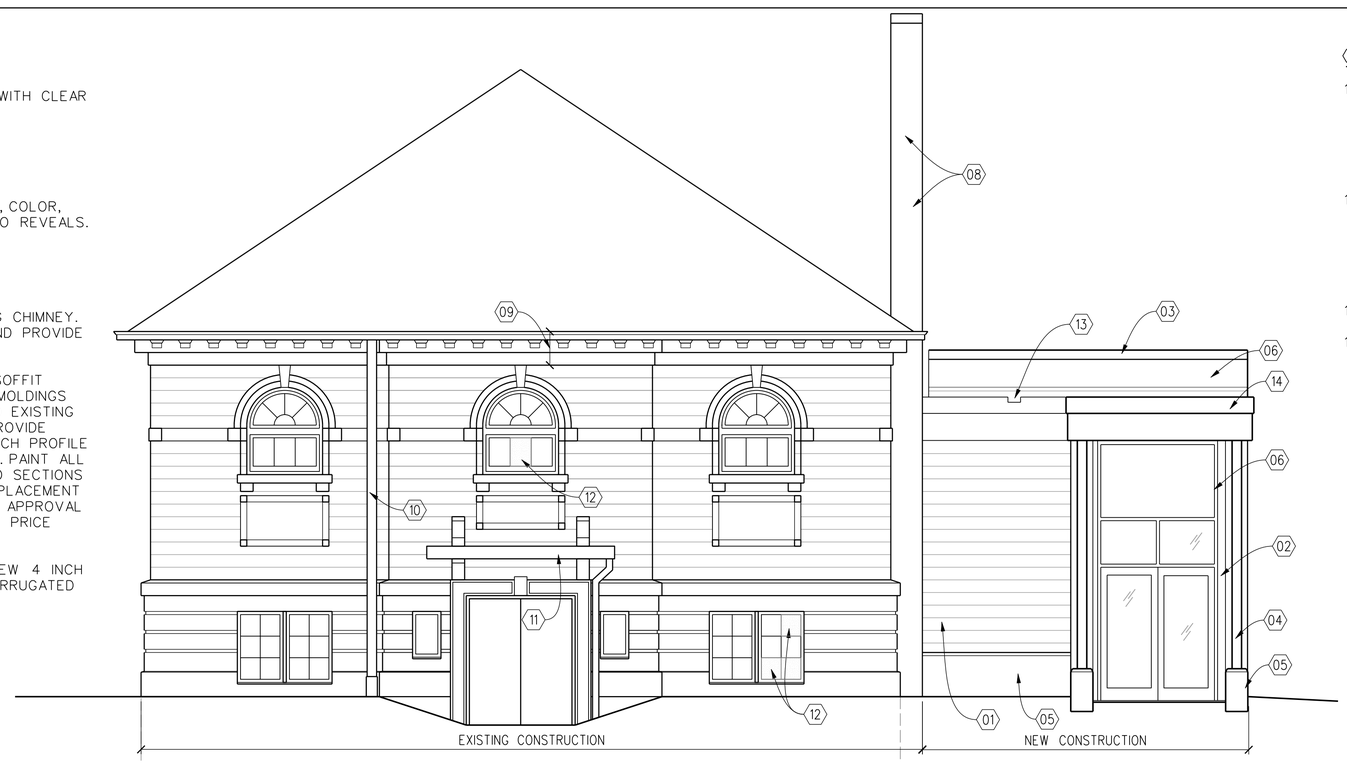


## DRAWING NOTES - CONTINUED

11. REPLACE DAMAGED SOFFIT BOARDS. COVER ENTIRE AREA WITH ALUMINUM SOFFIT PANELS. REPAIR AND PAINT ORNAMENTAL BRACKETS AND REPLACE EXISTING PVC DOWNSPOUT WITH NEW PREFINISHED GALVANIZED STEEL CORRUGATED ROUND DOWNSPOUT, SIZE TO MATCH EXISTING.

12. REPLACE BROKEN OR MISMATCHED PIECES OF GLASS (SHOWN SHADED). REPLACE BROKEN OR MISMATCHED GLASS PIECES ON LOWER LEVEL WITH TRANSLUCENT PATTERN GLASS TO MATCH EXISTING. REPLACE BROKEN OR MISMATCHED GLASS PIECES ON UPPER LEVEL WITH CLEAR GLASS TO MATCH EXISTING.

13. OVERFLOW SCUPPER

14. PREFINISHED METAL FASCIA

WEST

ELEVATION

1/4 SCALE 0 2 4 6FT

01

| NO. | DATE |
|---|---|
| 01 | 10-14-2011 FOR BIDDING |
| 02 | 10-31-2011 FOR PERMIT |
| 03 | 01-17-2012 FOR BIDDING & PERMIT |

# Alterations & Additions to Former Carnegie Library for New City Hall for North Vernon, Indiana

143 East Walnut Street
North Vernon, IN 47265


KZF DESIGN
Architecture | Engineering | Interiors | Planning

KZF DESIGN INC.
700 Broadway Street
Cincinnati, OH 45202-6000

TEL 513 621 6211
FAX 513 621 6530
WEB www.kzf.com


| DESIGNED | COMM. NO. |
|---|---|
| LEWIS | 5917.00 |
| DRAWN | DATE |
| LEWIS/SAID | 01-17-2012 |
| CHECKED | PROJ. MANAGER |
| BARTOLT | M. SMITH |

EXTERIOR ELEVATIONS

DRAWING NUMBER: A202
ISSUE: 03